



Installation:

1. Remove the existing 900 lighthouse and gasket from the mounting surface.
2. Using the M9 conversion flange as a template, mark the (4) mounting hole locations onto the mounting surface. Drill a .250" hole in each location.
3. Draw a vertical line from the center of each of the upper mounting hole locations to the center of each of the lower mounting hole locations (see diagram). Locate the exact midpoint of each of the 2 vertical lines. Drill a .625" hole in each of these locations.

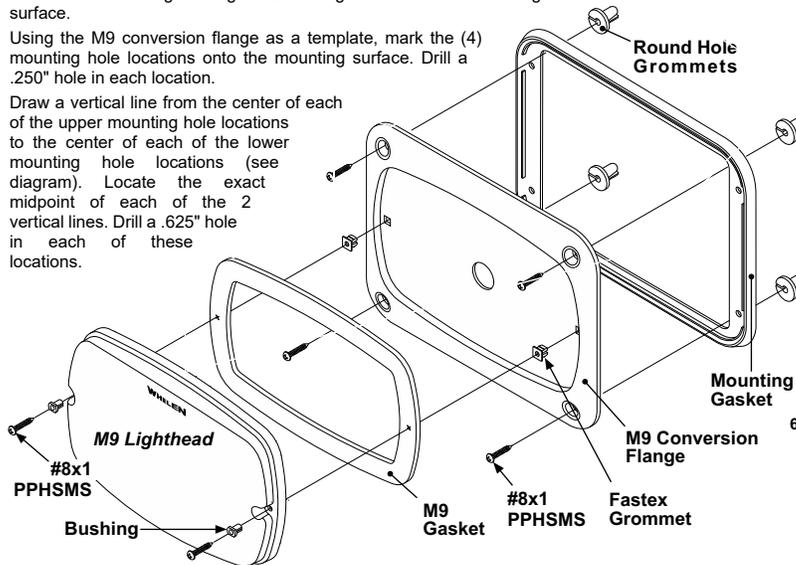

4. Assemble the bushing, lighthouse, gasket, Fastex grommets and conversion flange as shown. Insert the #8 x 1" screw as shown and tighten the assembly together.
5. Insert the 4 Round Hole Grommets into the 4 mounting holes. Position the lighthouse assembly onto the mounting gasket and against the mounting surface. Secure the assembly to the mounting surface using the #8 x 1" sheet metal screws.
6. Extend the wires to your power source and connect as shown in the lighthouse manual.

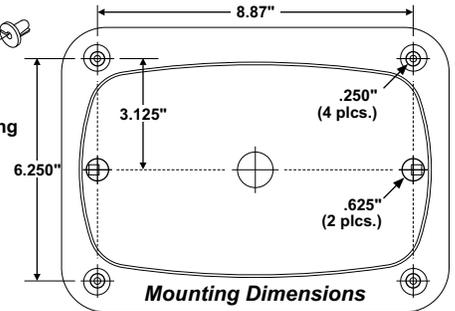


©2009 Whelen Engineering Company Inc.
Form No.14336A (101218)


For warranty information regarding this product, visit www.whelen.com/warranty

Installation:

1. Remove the existing 900 lighthouse and gasket from the mounting surface.
2. Using the M9 conversion flange as a template, mark the (4) mounting hole locations onto the mounting surface. Drill a .250" hole in each location.
3. Draw a vertical line from the center of each of the upper mounting hole locations to the center of each of the lower mounting hole locations (see diagram). Locate the exact midpoint of each of the 2 vertical lines. Drill a .625" hole in each of these locations.

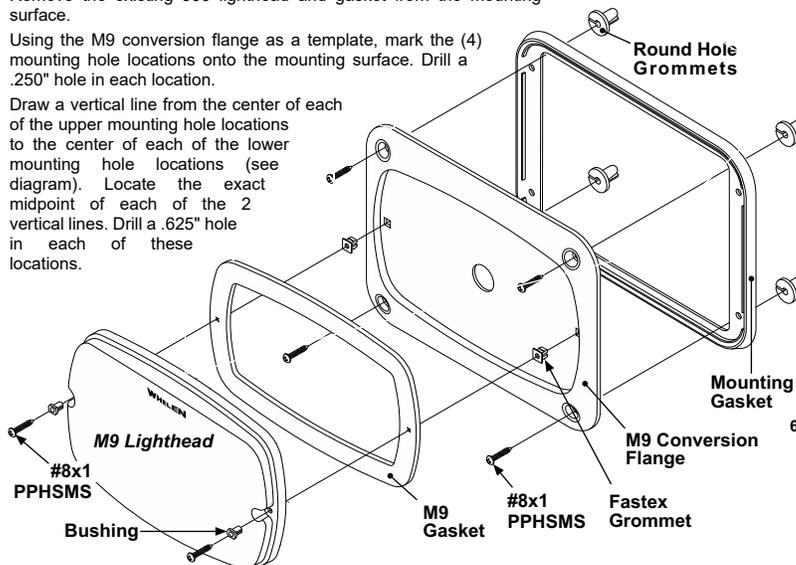

4. Assemble the bushing, lighthouse, gasket, Fastex grommets and conversion flange as shown. Insert the #8 x 1" screw as shown and tighten the assembly together.
5. Insert the 4 Round Hole Grommets into the 4 mounting holes. Position the lighthouse assembly onto the mounting gasket and against the mounting surface. Secure the assembly to the mounting surface using the #8 x 1" sheet metal screws.
6. Extend the wires to your power source and connect as shown in the lighthouse manual.

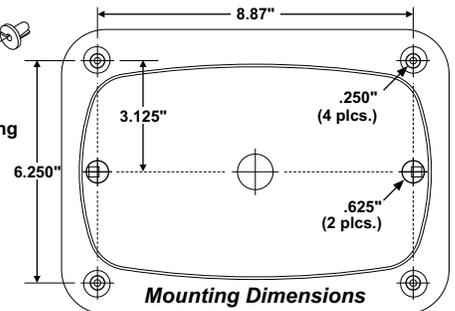

©2009 Whelen Engineering Company Inc.
Form No.14336A (101218)

For warranty information regarding this product, visit www.whelen.com/warranty