



Zip's Truck Equipment

316 W. Milwaukee Street
New Hampton, Iowa 50659
Phone: 641-394-3166
Fax: 641-394-4044



FIELD iD

Visual Inspection

Page: 1 of 7

Customer: _____

Address: _____

Serial No: J12070

Equipment Type: Car Carrier

Event Performed: Car Carrier Inspection

Result: Pass

Inspected By: _____

Division: null

Location: _____

Phone: _____

Reference #: 1GBJ6J1C13F503320

Order #: _____

Inspected On: 06/22/15 10:52 AM CDT

Total Score: _____

Comments: _____

Michigan Shop Service Tech 1

Car Carrier-J12070

* Year: 2003

* Make: Chevrolet

* Model: C6500

* Engine Make: CAT

* Engine Model: 3126

* Horse Power: 330

* Fuel Type: Diesel

* Transmission Type: Automatic

* Transmission Brand: Allison

* Odometer Reading: 351772

* GVW: 25,950#

* GAWR Front: 8,000#

* GAWR Rear: 17,500#

Rear Vision Camera System/Brand: No

Remote Keyless Entry: No

* Cab to Axle: 144"

* Wheel-Base: 211

Wheel Type: Aluminum/Steel

* Cab Color ONLY: Red

* Body Make: Jerr-Dan

* Body Length: 21'

* Body Model: Steel

Body Width: 96"

* Beacon/Lightbar Make: Whelen

* Beacon/Lightbar Model: Justice

Directional Lightbar/Brand: No

Work Lights In Lightbar: Yes

* Side Puller Make: No

Switch Panel & # Of Switches: Switch Panel - 4

In Cab Throttle: Yes

* Bed/Side Puller/Pylon Color ONLY: Black

* Brake Type: Hydraulic

* Suspension Type: Spring

* Air Compressor-FOR Brake System: Yes

Engine Brake: No

Air Dryer: No

* Air Conditioning: Yes

* Radio: AM/FM/CD

Navigation System/Brand: No

* Driver Seat: Cloth Air Ride High Back

Passenger Seat: Cloth 2 Man High Back w/Fold Down Console

Windows: Power

Door Locks: Power

Window Deflectors: Yes

Rear Sliding Window: No

Cruise Control: Yes


Tilt Steering Wheel: Yes


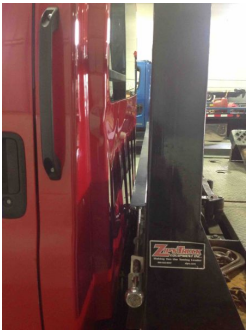
Owner:		Location:	
Air Horn:	Yes	Stop/Turn/Tail On Pylon:	Yes
Flooring:	Rubber or Vinyl	Extra Lights on BED/Where:	No
Floor Mats:	Yes Rubber or Vinyl	Crossmembers (Steel beds only):	12" Spacing
Bug Shield:	No	Bed Mounted D-Rings & #:	NA
Sunvisor:	No	Stake Pockets & #:	NA
* Bumper:	Chrome	Key Slots & #:	Yes 10 Key Slots
Grille:	Painted	Bed Floor Type:	Steel
Front Tow Hooks:	Yes 2	Toolbox System/Where:	1-36" Steel - RT Side 1-48" LT Side
Engine Block Heater:	Yes	Open Top Storage & Size:	Yes - 48" LT Side
Extra Lights on CAB/Where:	No	Dri-Dek In Toolboxes:	No
Jumper Cable Plug/Where:	No	Air Hose Reel/Mounted Where:	No
Jumper Cable:	No	Auxiliary Air Compressor:	No
Mirrors:	Power/Heated/Lighted Swing Out	Snatch Blocks:	Yes 1
Additional Mirrors:	Convex Mirrors	V-Chain/V-Strap Assemblies:	Yes V-Chain Assembly
Spot Light:	None	J-Chains & #:	Yes 1 Set
Fuel Tank/Where:	2 Steel - R&L	Straps/Rachets:	Yes Both
Vertical Exhaust Stack:	No	Fire Extinguisher:	No
Cab Roof Marker Lights:	Yes	Warning Triangle Kit:	Yes
Tread Type Rear:	Mud & Snow	Tow Light System:	Wireless
* Tire Size-Front:	225/70R19.5	Dual Controls:	Yes
Tire Depth-Front:	4/32	Front/Rear Safety Chains:	Yes Rear Only
* Tire Size-Rear Axle:	245/75R22.5	Light Plug Ins:	Yes CR6
Tire Depth-Rear Axle:	7/32	Hook Up Lights:	No
Top Hat Kit:	Axle Cover and Lug Nut Covers-some	* Wheel Lift/Wheel Lift Arms:	Yes with L-Arms
Lug Nut Covers:	Yes-some	Wheel Lift Style:	Basic L-Arm Style
Sub-Frame Finish:	Painted	Live Air Hook Up/Where:	Yes - Above RT Fuel Tank
Dump Angle:	Normal	Gas Cans/holders/Where:	No
Dock Stabilizer:	No	Trash Cans/holders/Where:	No
Side Rails:	Steel Fixed	Self Loading Dollies:	No
Rub-Rails:	No	Go-Jaks:	No
# of Winches:	1	Trailer Hitch:	Built-In
Winch Brand:	Ramsey	Special Equipment Storage/Where:	Yes- broom and Shovel mounts on top of LT toolbox
Winch Capacity:	8,000# Worm Type		
Winch Clutch Release:	Yes Mechanical		
Winch Work Lights:	No		
Cable Tensioner:	Yes		
Cable Roller Guide:	Yes		
Remote Control:	No		
Pylon/Cab Guard:	Standard Steel		
Work Lights:	No		

Inspector Name	Status	Comments
Enter name here	Mark/Andy	
Engine Check	Status	Comments
Ability to Start	Starts Normally	
Engine Blow-By Check	Has Excessive Blow-By	
Engine Oil Leaks	Oil leak observed (see Comments)	-Front main , left side of engine wet

Owner: _____


Location: _____

Engine Check	Status	Comments
Engine Noise	Engine sounds are normal	
Engine Warning Lights	Multiple Lights are on (See Comments)	-Cluster bad
Engine Water Leaks	No Water Leaks	
Performance	Performs Normally	
Engine Mounts	In Good Condition	
Other Engine Notes		
Engine Brake		
Batteries	Status	Comments
Condition of Cables	In Good Condition	
Condition of Batteries	Do Not Hold Charge Due to Battery	-Replace
Load Test	Fail	
Cooling System	Status	Comments
Radiator	In Good Condition	
Fan	In Good Condition	
Fan Clutch	In Good Condition	
Fan Shroud	In Good Condition	
Water Hoses	In Good Condition	
Fan Belt	Worn or Frayed	-Replace belt and tensioner, tensioner coming apart belt on very edge.
Other Cooling Condition Notes		
Automatic Transmission Check	Status	Comments
Transmission Operation		
Other Transmission Notes		
Manual Transmission Check	Status	Comments
Shifting		
Clutch Operation		
Throw-Out Bearing		
Transmission Noise		
Other Transmission Notes		
Overall Body Condition	Status	Comments
Overall Condition	Fair	
Other Overall Body Condition notes		
Cab Exterior	Status	Comments
Hood	Dented or Cracked	
		
Right Fender	Dented or Cracked	

Cab Exterior	Status	Comments
		
Left Fender	Excellent Condition	
Grille	In Good Condition	-Emblem missing
Back of Cab	Dented	
		
Driver Side Door	Good Condition	-Bent visor broken
Passenger Side Door	Good Condition	
Roof	Good Condition	-One nickle sized rust spot
Other Cab Exterior Notes	Door handle broken	-Rah side handle broke.
Fuel Tank Appearance	Rusty and in Need of Paint	
Entry Steps	Bent	-Pass side bent
Head-Light Doors	Cracked/Broken or Missing	
Battery Box	Rusty - Needs Paint	
Driver Side Door Hinges	Worn - Should Be Replaced	-Needs entire hinge replaced top and bottom
Passenger Side Door Hinges	Worn - Should Be Replaced	-Replace pins and bushings
Front Bumper	Status	Comments
Factory Front Bumper	Dented/ Scratched or Rusted	-Bent badly

Owner: _____

Location: _____

Front Bumper	Status	Comments
		
Front Push Bumper		
Glass Condition	Status	Comments
Windshield	Small Rock Chip	
Driver Side Window	Good Condition	
Passenger Side Windw	Good Condition	
Back Window	Good Condition	
Other Glass Condition Notes		
Overall Interior Condition	Status	Comments
Overall Condition	Poor	
Other Overall Interior Notes		
Interior Condition	Status	Comments
Drivers Seat	Fair Condition	-Small hole in seat back, seat mech stuck forward.
Passenger Seat	Good Condition	
Rear Seat		
Floor Mat	Excellent Condition	
Instrument Cluster	Good	-Voltage fuel oil all inop. Cosmetically good shape
Dash	Cracked or Loose	-Radio improperly secured. Warning light panel loose
Door Panels	Cracked or Loose	-Few cracks in drivers side. Lower part loose. Pass side missing
Electric Door Locks	Excellent Condition	
Other Interior Condition Notes	Horns	-Air horn cable broke. City horn low note inop
Electric Windows	Operate Properly	
Door Handles	In Good Condition	
Air Vents	Vent Missing or Broken	-Don't close.
Headliner	In Excellent Condition	
Other Interior Notes	Center console lid broke / power mirrors	-Power mirror switch cuts out.
Door Seals	In Poor Condition	
Floor Mats		
Seat Belts	In Good Condition	
Windshield Wipers	Status	Comments
Wiper Arms	In Good Condition	
Wiper Blades	In Good Condition	
Washer Tank	In Good Condition	
Washer Control Switch	In Good Condition	

Heating	Status	Comments
Heater Controls	Inoperative	
Fan Motor	Inoperative	
Heater		
Other Heat Notes		
Air Conditioning	Status	Comments
Overall Condition	Inoperative - Unknown Reason	
Air Conditioning Controls	Need Attention	
Electrical System-Chassis	Status	Comments
Interior lights	All Interior Light Operate	
Turn Signals	Some Lights Inoperative	-Rf inop
Head Lights	Operate Normally	-Pass side loose
Alternator	Performs Normally	
Guages	Bad Gauges (see Comments)	-Fuel volt oil bad
Dash Lights	Dash Lights Inoperative (see Comments)	-Ind. bulbs inop
Cab Marker Lights	Marker Lights Perform Normally	
Back-Up Lights	Left inop right side worked	
Back-Up Alarm	Doesn't Operate	
4-Way Flashers	R front not working	
Windshield Wipers	Perform Normally	
Other Electrical System Notes	Wiring all over truck. Needs to be cleaned up	
Cruise Control		
Engine Throttle	Operates Normally (Note Type) Push button	-Operated by factory pto switch. Switch worn out and won't always stay engaged.
Drive-Line	Status	Comments
U-Joints	In Good Condition	
Rear Differential	In good condition	
Transfer Case		
Other Drive-Line Notes		
Hanger Bearings	In Good Condition	
Brakes	Status	Comments
Air Compressor		
System Air Leaks		
Air Dryer		
Applied Brakes	Pedal goes to floor	-Fluid contaminated and lines leaking Replace master and all components with rubber seals after flushing contaminated fluid out
Brake Adjusters		
Air Lines	Brake lines	-Brake line repairs from master cyl. to ABS are unit leaking.
Low Air Pressure Warning		
Front Brake Drums	Rotors	-Deep lip outer edge and surface rust
Front Drive Axle Brake Drums		
Front Brake Calipers	In Good Condition	-Fluid contaminated replace after flushing lines thoroughly.
Front Brake Linings	60 or Better	
Pusher Axle Brake Drums		
Pusher Axle Brake Linings		

Owner: _____

Location: _____

Brakes	Status	Comments
Front Drive Axle Brake Linings	Under 50%	
Rear Drive Axle Brake Drums		
Rear Brake Calipers	In Good Condition	-Fluid contaminated replace after flushing lines thoroughly.
Rear Drive Axle Brake Linings		
Emergency Brake	Performs Normally	
ABS Light	Showing Normal (Not on)	
Brake Pedal Pads	Worn	-Worn through
Other Brake Notes		
Shock Absorbers	Status	Comments
Front Shocks	In Good Condition	
Rear Front Shocks	In Good Condition	
Wheels	Status	Comments
Front Axle Rims/Wheels	Wheel In Good Condition	
Pusher Axle Rims/Wheels		
Front Drive Axle Rims/Wheels	Wheel In Good Condition	
Front Drive Axle Nuts and Studs (2) (2)	In Good Condition	
Rear Drive Axle Rims/Wheels		
Fronts Axle Nut and Studs	In Good Condition	
Pusher Axle Nut and Studs		
Rear Drive Axle Nuts and Studs		
Wheel Simulators Front Axle		
Wheel Simulators Pusher Axle		
Wheel Simulators Front Drive Axle	Missing	
Wheel Simulators Rear Drive Axle		
Aluminum Wheels Front Axle	In Fair Condition	-Nut covers dented/ missing hub cover missing
Aluminum Wheels Pusher Axle		
Aluminum Wheels Front Drive Axle		
Aluminum Wheels Rear Drive Axle		
Wheel Hubs	Status	Comments
Front Wheel Seals	In Good Condition	
Pusher Axle Wheel Seals		
Front Drive Axle Wheel Seals	In Good Condition	
Rear Drive Axle Wheel Seals		
Oil Filled Hubs Front Axle	In Good Condition	
Oil Filled Hubs Pusher Axle		
Oil Filled Hubs Front Drive Axle	In Good Condition	
Oil Filled Hubs Rear Drive Axle		
Front Wheel Bearings	Not Adjusted but No Issue Visible	
Front Drive Axle Wheel Bearings	Not Adjusted but No Issue Visible	
Pusher Axle Wheel Bearings		
Rear Drive Axle Wheel Bearings		
Tires	Status	Comments
Front Axle	In Fair Condition 50% or Better	

Tires	Status	Comments
Pusher Axle		
Front Drive Axle	In Good Condition 60% or Better	
Rear Drive Axle		
Notes on Tires		
Exhaust System	Status	Comments
Manifold	In Good Condition	
Exhaust Tubing	Leaking at Clamp	-Loose under trans
Muffler	In Good Condition	
DPF System		
Emmissions Warning Light		
Exhaust Shield		
Exhaust Stack		
Exhaust Mounting Bracket	Need Attention	-Loose
Frame	Status	Comments
Integrity of Frame	In good Condition	
Suspension	Status	Comments
Air Bags		
Air Leaks		
Air Lines		
Spring Packs	Has Cracked/Broken Spring	-Lr leaf broken RR two broken leaves
Front Spring Hangars	In Good Condition	
Rear Spring Hangars	In Good Condition	
Radius Arms		
Rear Suspension Bushings	In Good Condition	
Air Leveling Valve		
Steering and Front Axle	Status	Comments
Steering Pump	Has Oil Leak	
Steering Lines	Leak	-Suction Line leaking at pump
Steering Sector	In Good Operating Condition	
King Pins/Ball Joints	Need Replacing	-Worn out.
Steering Shaft	In Good Condition	
Pitman Arm	In Good Condition	
Drag Link	Loose or Worn Joints	-Replace!
Tie Rod	In Good Condition	
Toe in Check	Not Checked	
4x4 Hubs		
Steering Wheel	Steering Wheel in Poor Cosmetic Condition	
Steering Wheel Position		
Fuel System	Status	Comments
Fuel Gauge	Doesn't Register at All	-Broken
Fuel Tank	In Good Condition	
Fuel Fill	Fills Normally	
Fuel Lines	In Good Condition	
Fuel Filter	Not Replaced	
Glow Plugs or Exhaust Heater	Status	Comments
Glow Plug Operation	Glow Perform Normally	
Intake Manifold Heater		
Fluids	Status	Comments

Owner: _____

Location: _____

Fluids	Status	Comments
Windshield Washer	Low	
Engine Oil	Low Oil Level	
Radiator Anti-Freeze	Full and Tested to 20 Below	
Transmission Fluid	Low	
Transfer Case Oil		
Front Drive Axle	Low	
Rear Drive Axle		
Battery Acid Levels		
Hydraulic Oil	Low Level	
Brake Fluid	Low	-Contaminated
Power Steering Fluid	At Proper Level	-Contaminated
Winch 1 Oil	Filled to Prope Level	
Winch 2 Oil		
Winch 3 (Above Cab) Oil		
Filters	Status	Comments
Water Filter	Original (Not replaced)	
Engine Oil Filter	Original (Not replaced)	
Transmission Oil Filter	Original (Not replaced)	
Fuel Filter	Original (Not replaced)	
Carrier Hydraulic System	Not Changed	
Engine Air Filter	In Need of Replacement	-Replace
Chassis Lubrication Points	Status	Comments
King Pins/Ball Joints	Appears Dry	
Tie-Rods Ends	Appears Dry	
Steering Shaft Bearing	Appears Dry	
Drag Link	Appears Dry	
Clutch Linkage		
Throw-Out Bearing		
Drive-Line U-Joints	Appears Dry	
S-Cam Shafts		
Slack Adjusters		
Spring Hangars		
Door Locks and Hinges	In Need of Lubrication	
Overall Car Carrier Condition	Status	Comments
Overall Condtion	Good	
Carrier Deck	Status	Comments
Aluminum Deck Condition		
Steel Deck Condition	Is Wash-Boarded	
Aluminum Deck Side-rails		
Steel Deck Side-rails	In Excellent Condition	
Steel Deck Side-rails Paint	In Good Conditon	
Aluminum Tail Section		
Rear Rollers		
Re-movable Side Rails Steel		
Re-movable Side Rails Aluminum		
Anti-Tilt Protection System	N/A	
Power Take-Off	Status	Comments
Operation	Operates Normally	
Oil Leaks	No Oil Leaks	
PTO Warning Light	Inoperative	
Shifting Mechanism	Electrical Switch Working Properly	
Air Leaks		

Hydraulic Pump	Status	Comments
Oil Leaks	No Oil Leaks	
Operation	Pump Operates Normally	
Pump Pressure	Tested to 2500#	
Pump Flow	Not Tested	
Control Valve	Status	Comments
Oil Leaks	No Oil Leaks	
Operation	Functions Do Not Perform Properly	-Washers missing on pivot shafts causing handles to hit mounting bolts
Control Levers and Rods	In Excellent Condition	
Control Box	In Good Condition	
Knobs	In Good Condition	
Control Decals	Missing or in Need of Replacement	-Pass side missing
Hydraulic System Hoses	Status	Comments
Oil Leaks	In Operating Condition	
Hydraulic System Leaks	Status	Comments
Winch Hoses	No Oil Leaks	
Lift Cylinder Hoses	No Oil Leaks	
Extension Cylinder Hoses	No Oil Leaks	
Wheel-Lift Tilt Cylinder Hoses	No Oil Leaks	
Wheel-Lift Extend Cylinder Hoses (2)	Leaks at the Cylinder	-Loose/bad fitting at cylinder
Hydraulic Pump Hoses	No Oil Leaks	
Hydraulic Filter	No Oil Leaks	
Bed Lift Cylinders	No Oil Leaks	
Extend Cylinder	Oil Leaking	-Very wet
Wheel-Lift Tilt Cylinder	Oil Leaking	-Pass side leaking
Wheel-Lift Extend Cylinder	No Oil Leaks	
Wheel-Lift Claw Cylinder Drivers Side		
Wheel-Lift Claw Cylinder Passenger Side		
Pylon	Status	Comments
Overall Condition	In Excellent Condition	
Winch	Status	Comments
Oil Leaks	Leaking	-Leaking possible bad motor
Free-Wheel Mechanism Winch 1	Operates Normally	
Free-Wheel Mechanism Winch 2		
Free-Wheel Mechanism Winch 3		
Housing Winch 1	In Good Condition	
Housing Winch 2		
Housing Winch 3		
Operation Without Load	In Operative	-Seems to be skipping on winch out
Operation Without Load Notes		
Test Operation Loaded		
Test Operation Notes		
Winch 1 Cable	In Poor Condition	-Flattened and separated .
Winch 2 Cable		
Winch 3 Cable		
Cable Tensioner	Missing	-Missing, mounts missing
Wheel-Lift	Status	Comments
L-Arms/Scoops	In Good Condition	-Pass side missing
L-Arm Straps	Broken or Frayed Straps	

Owner: _____

Location: _____

Wheel-Lift	Status	Comments
L-Arm Storage	Broken or in Need of Repair	-Dr side coming loose pass side missing
Driver Side Claw		
Passenger Side Claw		
Driver Side Slide Tray	In Good Condition	
Passenger Side Slide Tray	In Good Condition	
Passenger Side Slide Tray Locks	Bent or Broken	-Bent frozen
Driver Side Slide Tray Locks (2)	In Good Condition	
Driver Side Front Stops (Vulcan)		
Passenger Side Front Stops (Vulcan)		
Driver Side L-Arm Swivel		
Passenger Side L-Arm Swivel (2)		
Center Pivot Pin and Bushing	Worn and in Need of Replacement	
Wheel-Lift Cross-Bar	In Good Condition	
Pins and Bushings	Worn and in Need of Replacement	-Front support bar very loose
Extension Tube	In Good Condition	
Outer Wheel-Lift Assembly	In Good Condition	
Wheel-Lift Swivel Lock Pins		
Wheel-Lift Swivel Lock Pins (2)		
Scoop Locking Pins and Chains		
Driver Side Claw Cylinders		
Wear Pads	Missing or In Need of Replacement	-Missing
Carrier Electrical Systems	Status	Comments
Switch Panel	In Good Condition	
Overall Wiring Condition	In Need of Considerable Repair	
Bed Wiring Harness Condition	In Good Condition	
Junction Boxes Condition	In Need of Replacement	-Bed mounted box broken
Marker Lights	Some Lights Inoperative	
Driver Side Turn Signals Upper	In Excellent Condition	
Passenger Side Turn Signals Upper	In Excellent Condition	
Driver Side Turn Signals Upper Lower	In Good Condition	
Passenger Side Turn Signals Lower	In Good Condition	-Dim
Extra Warning Lights		
Extra Clearance Lights		
Upper Work Lights	In Excellent Condition	
Lower Work Lights	Lights Missing (See Comments)	-Broke off
Work Lights Mounted Near Winch		
Beacon Light	Flashing Segments Inoperative (See Comments)	-Pass rear corner head inop
Tow Light Plug at Tail-Board	In Good Condition	-Lh turn in tow light inop, No charge cord for tow light.
License Plate Light	Inoperative (See Comments)	-Inop
Tool Boxes	Status	Comments

Tool Boxes	Status	Comments
Box Driver Side 1	In Good Condition	-No keys chain missing, need to adjust latch.
Box Driver Side 2		
Box Passenger Side 1	In Good Condition	-No keys chain missing, need to adjust latch.
Box Passenger Side 2		
Fenders	Status	Comments
Drivers Side		
Passenger Side		
Carrier Components	Status	Comments
Bed Hold-Downs	In Need of Adjustment	-Bent
Rear Bed Mounting (Pivot Pin)	In Need of Repair	-Pins broken
Driver Side Tail-Light Housing	In Need of Repair	-Loose improperly mounted
Passenger Side Tail-Light Housing (2)	In Need of Repair	-Loose, improperly mounted
Rear Tail Section	In Need of Repair	-Chain holders bent. Chain pocket back panels loose
Body Lubrication Points	Status	Comments
Bed Pivot Pin	Appears Dry	
Lift Cylinder Pins	Appears Dry	
Wheel-lift Tilt Pin	Appears Dry	
Wheel-Lift Pivot Pin	Appears Dry	
Wheel-Lift Upper Slide Pads	Appears Dry	
Wheel-Lift Lower Slide Pads	Appears Dry	
Deck Slide Back Wear Pads	Doesn't Take Grease	
Tool Box Door Hinges and Locks	In Need of Lube	
Carrier Chains	Status	Comments
Front Safety Chains	Broken or Missing	-Not equipped
Rear Safety Chains	Broken or Missing	-Lh side missing hook rh side needs replacement.
V-Chains Chains	In Excellent Condition	
V-Chains Straps	Worn or Damaged	-One j chain link ground down thin
Mud-Flaps	Status	Comments
Mounting Brackets	In Need of Repair	-Bent
Mud-Flap	In Good Condition	-Pass side weight needs straightening